


# Laskin Road Safety Project Short Term Improvements

Citizen Information Meeting - April 18, 2013

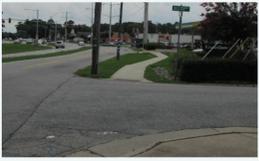

## Suggested Short Term Improvements

Locations	Safety Issues	Suggested Improvements	Photos
<b>Chapel Lake Drive WJCT and EJCT</b>	Southbound Chapel Lake Drive has no stop bar.	<b>Short Term:</b> Paint stop bar.	
	Yield sign on the eastbound north access road on Laskin Road is not appropriate at this intersection.	<b>Short Term:</b> Replace yield sign with stop sign. Paint stop bars.	
	Degradation to the stop sign face on SB Chapel Lake approach.	<b>Short Term:</b> Replace and straighten stop sign.	
<b>Bratten and Phillip Avenue</b>	Stop bar not present on southbound approach.	<b>Short Term:</b> Paint stop bar.	
<b>Maxey Drive</b>	Stop bar is not present on the northbound approach.	<b>Short Term:</b> Paint stop bar on northbound Maxey Drive.	
<b>Regency Hilltop Drive</b>	Regulatory lane use sign conflicts with pavement markings.	<b>Short Term:</b> Correct inconsistent pavement marking to clarify access to the north access road departure leg.	
	From field observations, left turn signals remain green with no traffic present causing unnecessary delay.	<b>Short Term:</b> Check signal timings to improve peak period efficiencies.	
<b>Regency Drive</b>	Vegetation blocking existing sidewalks.	<b>Short Term:</b> Trim vegetation back such that the entire existing sidewalk can be utilized.	
<b>Hilltop Road</b>	Stop bar not present on southbound approach.	<b>Short Term:</b> Paint stop bar.	
	Worn stop sign.	<b>Short Term:</b> Replace stop sign.	
	Tripping hazard adjacent to sidewalk.	<b>Short Term:</b> Check for any drainage issues and backfill hole as appropriate.	

# Laskin Road Safety Project Short Term Improvements

Citizen Information Meeting - April 18, 2013



## Suggested Short Term Improvements

Locations	Safety Issues	Suggested Improvements	Photos
<b>Village / Victor Road</b>	Stop bar not present for the Village Drive approach. Vegetation may cause sight distance issues for drivers to see pedestrians and vehicles.	<b>Short Term:</b> Paint stop bar. Trim vegetation.	
	Stop bar and double arrow warning sign (W1-7) not present.	<b>Short Term:</b> Install stop bar and double arrow warning sign at Victor Road.	
<b>Republic Road</b>	Worn pavement markings.	<b>Short Term:</b> Repaint markings.	
	No pedestrian accommodations including: crosswalk, ADA ramps, and pedestrian countdown signals.	<b>Short Term:</b> Install pedestrian countdown signals with mast arms.	
<b>Hilltop Plaza</b>	Worn pavement markings.	<b>Short Term:</b> Repaint pavement markings to better delineate lane use.	
	Pedestrian accommodations such as sidewalks, countdown signals, and crosswalks are not present.	<b>Short Term:</b> Install pedestrian countdown signals and crosswalks.	
	Worn regulatory sign on northbound approach.	<b>Short Term:</b> Replace regulatory signs.	
<b>First Colonial</b>	Pedestrian countdown signals are not present.	<b>Short Term:</b> Install pedestrian countdown signals.	
	Skewed spanwire signal design does not provide the best visibility for traffic throughout the intersection.	<b>Short Term:</b> Replace spanwire with mast arm design.	
	Worn pavement markings.	<b>Short Term:</b> Repaint pavement markings.	
	Queue spillback from transit stop on southbound First Colonial.	<b>Short Term:</b> Locate transit stop further south where existing auxiliary lanes will act like a transit pullout bay.	

# Laskin Road Safety Project Short Term Improvements

Citizen Information Meeting - April 18, 2013



## Suggested Short Term Improvements

Locations	Safety Issues	Suggested Improvements	Photos
Nevan Road	Stop sign is not present on southbound North Hilltop Approach.	<b>Short Term:</b> Install stop sign.	
	Legacy guardrail installation has an unclear need.	<b>Short Term:</b> Consider removing guardrail installation to eliminate a fixed object.	
	Pedestrian access issues.	<b>Short Term:</b> Consider a pedestrian friendly and ADA-compliant design and installing crosswalks.	
Hilltop North Shopping Center WJCT	Right-out only for southbound driveway to mainline Laskin Road.	<b>Short Term:</b> Consider moving stop bar forward.	
Hilltop East Shopping Center	School marking faded on eastbound approach to Winwood Drive.	<b>Short Term:</b> Replace SCHOOL markings.	
	Faded stop bars and double yellow markings.	<b>Short Term:</b> Replace stop bar and double yellow markings.	
	Stop bars, lane control arrows, and longitudinal lines are not present on the southbound approach.	<b>Short Term:</b> Install stop bars, lane control arrows, and longitudinal lines.	
Winwood Drive	Stop bar not present on the northbound Winwood approach.	<b>Short Term:</b> Install stop bar.	
	Stop bar not present on southbound Winwood approach.	<b>Short Term:</b> Install stop bar.	